

ANALYSTS, INC.



STATUS WAS AI

ENERGY MAINTENANCE SERVICE INC
 JOE KOLBACH
 P O BOX 158
 129 MAIN AVE
 GARY SD 57237

ISO 9001 REGISTERED
 2450 HASSELL ROAD
 HOFFMAN ESTATES, IL 60195
 (847) 884-7877 (800) 222-0071
 FAX: (847) 884-8098

Normal	ON	14-AUG-05
--------	----	-----------

UNIT I.D.: MEDICINE BOW, NY
 COMPONENT: TRANSMISSION
 COMP. REF. NO.: 794626
 P.O. / REF. NO.:

Attn: Jim

WORKSITE	UNIT MANUFACTURER DOES NOT APPLY	OIL TYPE UNSPECIFIED
COMPONENT TYPE TRANSMISSION	COMPONENT MANUFACTURER AND MODEL FLENDER GMBH 4Z1805 033-7-32	COMPONENT SERIAL NUMBER

MAINTENANCE RECOMMENDATIONS FOR LAB NO. 2671 Received on 18-AUG-05

ANALYSIS INDICATES COMPONENT & LUBRICANT CONDITIONS ARE ACCEPTABLE. If still in service, the oil is suitable for continued use. **RE-SAMPLE** at the next scheduled interval.


SPECTROCHEMICAL ANALYSIS IN PARTS PER MILLION BY WEIGHT

LAB NO	IRON	CHROMIUM	NICKEL	ALUMINUM	LEAD	COPPER	ZN	SILICON	TITANIUM	SILICON	BORON	SODIUM	POTASSIUM	MANGANESE	PHOSPHORUS	ZINC	CALCIUM	BARIUM	MAGNESIUM	ANTIMONY	VANADIUM	Sample Date
2671	4	<1	<1	<1	<1	<1	5	<1	<1	11	6	1	<10	<5	2821	28	<10	<10	<1	<30	<1	14-AUG-05

SAMPLE INFORMATION

PHYSICAL TEST RESULTS

LAB NO.	Mi/Hr Unit	Mi/Hr Oil	Oil WATER Add % VOL	VIS CS 40°C	TAN
2671			<10	242.9	1.91

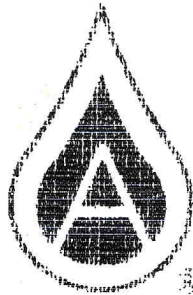

UNDERLINED FIGURES INDICATE SIGNIFICANT VALUES. MAINTENANCE THAT MAY BE REQUIRED IS INDICATED ABOVE UNDER MAINTENANCE RECOMMENDATIONS AND SHOULD BE PERFORMED BY A QUALIFIED MECHANIC. PLEASE ADVISE US OF ANY MAINTENANCE PERFORMED ON THIS UNIT.
 ACCURACY OF RECOMMENDATIONS IS DEPENDENT ON REPRESENTATIVE SAMPLE AND COMPLETE, CORRECT DATA ON BOTH UNIT AND SAMPLE. THIS REPORT IS NOT AN ENDORSEMENT OR RECOMMENDATION OF ANY PRODUCT OR SYSTEM. ORIGINAL REPORT MAINTAINED IN ANALYSTS, INC. DATA FILES.

FOR LEGEND AND EXPLANATION OF PHYSICAL PROPERTIES TESTS PLEASE SEE REVERSE SIDE
 N/R = TEST NOT PERFORMED